

APPENDIX L.2

ARCHITECTURAL INVENTORY

SITE CH39**TOWNLAND:**

Grousemount

CLASSIFICATION:

Dwelling/Bothán

ITM:

509732 570846

This comprises a small single-storey former gable-ended dwelling constructed in stone; single door-ope in SE-facing façade and single squared window op on NE gable; replacement corrugated iron roof. The structure is now in use as an agricultural shed and here are small stone-built animal enclosures to SE and S, the former of which incorporates a sheep-dipping feature.

**SITE CH40****TOWNLAND:**

Grousemount

CLASSIFICATION:

Dwelling &

Outbuildings

ITM:

509168 570956

A complex of 19th century buildings formed by three distinct and detached ranges, all of which are generally orientated N-S. These ranges are as follows:

- A. An eastern range of single-storey, gable-ended outbuildings with ridged roofs covered with sheets of corrugated iron; roofline indicates that southern section may be a later extension. The form of the northern end indicates that this may have been a dwelling, incorporating a central door and single window opes to either side.
- B. The central range comprises a two-storey habitable dwelling; gable-ended with replacement slate ridged roof and off-centre chimney. The east-facing façade incorporates a central doorway with single flanking windows; additional window to north and additional doorway to south providing access to store; six window bays to first floor; storage area on first floor of southernmost section of is accessed by external steps on southern gable.
- C. Range of single-storey, gable-ended outbuildings with ridged roofs of corrugated iron sheeting; Stone construction and painted with whitewash. The northern section of the building, incorporating a doorway and large window ope, now blocked up, may be a later extension; the southern section incorporates a central door ope and large flanking windows, all of which are blocked up; small window ope on southern gable. Access is now from rear through three modern door openings.



CH40A



CH40B



CH40C

SITE CH41

TOWNLAND:
Grousemount

CLASSIFICATION:
Lime Kiln

ITM:
508993 571032

Located in pasture land to the west, and immediately adjacent, the main existing access road.

This feature, of mid-late 19th century date, is constructed in stone and is partly ruinous and overgrown. The squared ope of the hearth area is on its southern façade.



SITE CH42

TOWNLAND:
Grousemount

CLASSIFICATION:
House Cluster

ITM:
508965 571156

This cluster of houses and associated outbuildings is indicated on the 1841-2 O.S. map, with some additions indicate on the 1895 edition.

The overall site, which is situated on falling ground to the west, is located on the western side of the main access road and comprises the following structures:

- A. Range of stone buildings orientated north-south with the eastern facades facing onto the road. In the northern side of the range is the ruined remains of a former dwelling, with internal remains of a chimney on its party wall; it originally had a central doorway with single window opes to each side. The southern end of the range, shares the chimney and is formed by single-storey structures, one of which may have formed a separate dwelling, and presently roofed with corrugated iron sheeting and used as animal housing. These all date to the early 19th century. To the south is a 20th century free-standing open barn constructed of steel uprights and with a corrugated iron roof



- B. Located immediately to the rear of A was a long range of gable-ended outbuildings constructed of stone with a slate roof. The façade faced west and originally incorporated four door openings. Much of this building collapsed during the winter of early 2010.
- C. To the northwest of B is a two-storey three-bay dwelling of late 19th century date. It is gable-ended with chimneys at both gables and incorporates a slated roof; orientated east-west with façade to south. The dwelling is in use and there is a small single-storey shed attached to the eastern gable. This is constructed in stone and has a galvanised iron roof.



- D. To the immediate west of C are the partially ruinous remains of a range of outbuildings constructed of stone. These consist of a two-storey loft structure with a single-storey extension to west. The former is roofed with galvanised sheeting but was roofed with slate until the early 2002.
- E. Located to the south of C is a single-storey outbuilding with a small low extension to west. Of early 19th century date, this building incorporates four doors on its northern façade and is presently roofed with galvanised sheeting.



- F. Located to the south of E are the semi-ruinous remains of a gable-ended, four-bay, two-storey former dwelling orientated east-west with façade facing north; The original gables incorporate chimneys and the structure was subsequently extended to the east and the roof of the overall structure was originally of slate. This is of early 19th century date.



SITE CH43

TOWNLANDS:

Grousemount

Knockanruddig

CLASSIFICATION:

Bridge

ITM:

508751 570932

This two-span concrete bridge over the Roughty River was constructed in the 1950s. It provides access to former dwellings in Knockanruddig townland. Prior to its construction, access was by means of a segmented road of large stones at a fording point, all of which were washed away by flooding in the early 1950s.



SITE CH44

TOWNLAND:

Knockanruddig

CLASSIFICATION:

Former Dwelling &

Outbuildings

ITM:

508685 570932

Situated on a man-made platform on east-facing slope overlooking the Roughty River, this site comprises:

- (a) Two-storey former dwelling with a small single-storey extension to side; some evidence to indicate that the dwelling was originally a single-storey cottage. Much of the building collapsed during winter storms of 2007-8.



- (b) There are two stone-constructed outbuildings to the site; one to the rear of the dwelling is very ruinous and overgrown while the other, to the front, has a galvanised roof and is used for storage.



SITE CH45

TOWNLAND:

Knockanruddig

CLASSIFICATION:

Former Dwelling & Outbuildings

ITM:

508712 570755

This complex of buildings, largely of early 19th century date, comprise the following:

- (a) An abandoned two-storey three bay dwelling with central chimney; blocked up central doorway; building was extended to north and south with present access doorway in southern extension; part of roof to northern extension has collapsed.



- (b) A partially ruinous stone outbuilding, now incorporating a low galvanised roof is situated to the front of the dwelling and used as an animal house. In addition, there is a modern concrete and steel barn to the south of the farmyard.



SITE CH46

TOWNLAND:

Knockanruddig

CLASSIFICATION:

Former Dwelling & Outbuildings

ITM:

508662 571040

This site comprises the ruined remains of a former agricultural farm of late 19th century date situated on the eastern side of an access trackway and on a platform overlooking the Roughty River.

It comprises the following:

- (a) A ruinous two-storey three-bay gable-ended dwelling with central doorway; constructed of stone and orientated east-west, with chimneys in each gable.
- (b) Two former single-storey outbuildings extend to the north alongside the road; both are single-storey, orientated north-south and in a general ruinous condition.



SITE CH47
TOWNLAND:
 Knockanruddig
CLASSIFICATION:
 Former Dwelling &
 Outbuilding
ITM:
 508646 571304

This site is bisected by a trackway and comprises the following late 19th century structures:

- (a) A disused former dwelling orientated north-south with façade on east, incorporating an original two-storey, three-bay house with central doorway and chimney on original northern gable; two-storey extensions to north and south forming a single, gable-ended range with a ridge slated roof; stone construction with a plaster render.



- (b) Single-storey detached gable-ended outbuilding incorporating three doorways and two small windows on its west-facing façade; largely covered with a concrete render and incorporating a corrugated iron ridged roof.



SITE CH48
TOWNLAND:
 Coolnagoppoge
CLASSIFICATION:
 Former Dwelling &
 Outbuilding
ITM:
 507958 571638

This site is bisected by a trackway and comprises the following late 19th century structures:

- (a) A relatively recently abandoned former dwelling orientated east-west with façade on north, incorporating a two-storey, four-bay house with doorway in eastern half and off-centre chimney; gable-ended; ridge slated roof; stone construction with a plaster render; square-headed window opes with timber six-pane windows on first floor and six-over-six pane sash windows on ground floor; replacement timber door; lean-to extension to rear.



(b) Single-storey detached gable-ended outbuilding incorporating single central doorway in west-facing façade; largely covered with white-washed render and incorporating a slated ridged roof.



(c) Single-storey detached gable-ended outbuilding incorporating single doorway in west gable; stone faced with corrugated-iron ridged roof.



SITE CH49

TOWNLAND:

Coolnagoppoge

CLASSIFICATION:

Farm Building

ITM:

507917 571650

This site is located on the edge of a trackway and comprises the following: Stone-built farm building of late 19th century date; orientated east-west with façade on north, gable-ended single-storey structure with two square-headed doorways and slit window/light opes on façade; small two-over two window frame set in a square-headed ope on east-facing gable; corrugated-iron ridged roof with a low lean-two extension with pitched corrugated-iron roof attached to east gable with separate doorway in north façade.



SITE CH50

TOWNLAND:

Coolnagoppoge

CLASSIFICATION:

Former Dwelling

ITM:

506840 571487

This comprises the ruinous remains of a single-storey structure of early 19th century date comprising stone-built gables surviving to almost full-height and low side walls, largely tumbled; orientated north-south; no evidence for a formal chimney. Structure is set in a former filed complex, for which very little evidence now survives except for a few short-stretches of dry-stone walling.



SITE BH5

RPS No.:

00366

NIAH No.:

20905805

TOWNLAND:

Gort na Tiobhratan

CLASSIFICATION:

Bridge - Road

ITM:

519540 577638

This structure is located at the western end of Ballyvourney village and provides a crossing over the River Sullane for the road to Kilgarvan. It comprises a triple-arch bridge, built c. 1830, with various recent alterations. Rubble and cut limestone construction with V-cutwaters and limestone voussoirs to segmental arches; cut limestone pilasters, piers, coping and string course.



Downstream elevation

SITE BH6

RPS No.:

N/A

NIAH No.:

20905803

TOWNLAND:

Cúil Aodha

CLASSIFICATION:

Séipél Ghobnatán Cúil Aodha – Plate 8

This structure comprises a freestanding, gable-fronted, Roman Catholic church, built 1871, with breakfront to west and recent extensions (east and west); 6-bay nave and single-bay, single-storey sacristy (west). Pitched slate roofs with rendered chimneystack, gabled cross finial (east) and cast-iron rainwater goods; painted smooth rendered and pebble-dashed walls with plat band and round-headed holy water font; round-headed openings with two-over-two timber sliding sash windows

Church/chapel
ITM:
516414 575907

and stained glass windows, having dressed limestone and concrete sills. Round-headed openings with single and double-leaf panelled doors. The street-frontage boundary comprises smooth and roughcast walls and cast-iron gates.



From east

SITE BH7

RPS No.:

N/A

NIAH No.:

20905802

TOWNLAND:

Cúil Aodha

CLASSIFICATION:

House

ITM:

516310 575902

This structure comprises a detached 3-bay, 2-storey house, over basement, built 1942, with extension to rear. It incorporates a hipped artificial slate roof with rendered chimneystacks and cast-iron rainwater goods; painted rendered walls; square-headed openings with three-over-three timber sliding sash windows, set in single and paired arrangements, with concrete sills; square-headed opening with timber panelled door and over-light. The street-frontage boundary comprises rendered walls with a timber gate.



Front/south façade

SITE BH8

TOWNLAND:

Caherdowney

Garraneycarney

CLASSIFICATION:

Bridge

ITM:

524646 583451

Garrane Bridge

Single segmental-arched bridge of stone construction over Garrane River; late 19th/early 20th century; stone parapets with concrete coping; flat road deck. Ground built up on either sides of valley to accommodate road.



View from east

SITE BH9

TOWNLAND:

Glenn Daimh

CLASSIFICATION:

Bridge/Culvert

ITM:

523550 581718

Stone bridge/culvert with central column; flat-roofed channels with flat road deck and no discernible parapet walls. Constructed in late 19th/early 20th century over a stream tributary of Foherish River. Valley/gorge built up on either side to accommodate road.

View from south



SITE BH10

TOWNLAND:

Glenn Daimh

CLASSIFICATION:


Bridge

ITM:

523063 581454

Single segmental-arched stone bridge over Foherish River; late 19th/early 20th century construction; flat road deck and no discernible parapet walls; boulders placed along stream banks to north of bridge in recent times and narrow valley built up on either side of bridge to accommodate road

North façade

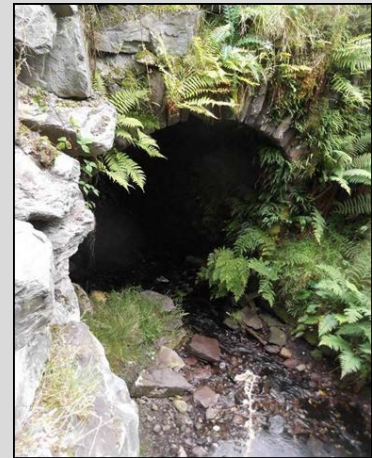

SITE BH11

TOWNLAND:

Com an Ghadhair

Com na Cloiche

CLASSIFICATION:

Bridge

ITM:

520519 579995

Single segmental-arched bridge over upper Bohill River; stone construction; late 19th/early 20th century date replacing a 'ford' marked on 1st ed. O.S. map. Flat road deck with stone parapet walls and edge coping; ground built up on either side of watercourse to accommodate road.



North façade

SITE BH12

TOWNLAND:

Com na Cloiche

An Cheapach Thiar

CLASSIFICATION:

Bridge

ITM:

520039 578908

Single segmental-arched bridge of fine cut stone over Bohill River; built late 19th /early 20th century replacing 'stepping stones' marked on 1st ed. O.S. map. Flat road deck with largely overgrown stone parapet walls and coping.



From upstream



Road deck & parapets

SITE BH13

TOWNLAND:

An Cheapach Thiar

CLASSIFICATION:

Bridge

ITM:

519909 578422

Cappagh Bridge – Plate 16

Single segmental-arched bridge over Bohill River; built late 19th /early 20th century replacing 'stepping stones' marked on 1st ed. O.S. map. The entire structure incorporates a concrete render associated with repairs undertaken towards end of 20th century. Flat road deck.



Southern elevation

SITE BH14

TOWNLAND:

An Lománach Mhór

CLASSIFICATION:

Bridge

ITM:

514001 574586

Ballyfinnane Bridge

Single segmental-arched stone bridge; of probable early 19th century date. Stone parapet walls with stone edge coping topped with concrete render. Slight hump on road deck. Bridge spans a gorge and is constructed on outcropping bedrock.



North elevation

SITE BH15

TOWNLAND:

Coolknoohil

CLASSIFICATION:

Bridge

ITM:

510587 573285

Single segmental-arched stone bridge; of probable early 19th century date and marked on 1st ed. O.S. map Stone parapet walls barely visible above road surface.



South elevation

SITE BH16

TOWNLAND:

Coolknoohil

CLASSIFICATION:

Kiln - lime

ITM:

510587 573285

This structure is located on the northern side of the Ballyvourney – Kilgarvan road and is not marked on any O.S. maps. It comprises an overgrown and partially collapsed lime kiln of probable 19th century construction; front elevation has a lintelled recess with sloping slabs to rear; set back from the road and adjacent a trackway.



Front/South façade

SITE BH17

TOWNLAND:

Grousemount

CLASSIFICATION:

Kiln - lime

ITM:

508989 571011

Located in pasture land to the west, and immediately adjacent, the main existing access road.

This feature, of mid-late 19th century date, is constructed in stone and is partly ruinous and overgrown. The squared open of the hearth area is on its southern façade.



Front Facade